Technical Service Information Bulletin

November 17, 2005

M.I.L. "ON" DTC P0171, P0174, P2195, OR P2197

'05 - '06 ES 330

Introduction

Under certain driving conditions, some 2005 and 2006 model year ES 330 vehicles may exhibit a M.I.L. "ON" condition with at least one of the following DTCs:

- P0171 (System Too Lean [Bank 1])
- P0174 (System Too Lean [Bank 2])
- P2195 (Oxygen [A/F] Sensor Signal Stuck Lean [Bank 1, Sensor 1])
- P2197 (Oxygen [A/F] Sensor Signal Stuck Lean [Bank 2, Sensor 1])

The Air Fuel (A/F) sensor manufacturing process has been improved to correct this condition. The following repair procedures should be used to properly diagnose and repair the affected vehicles.

Applicable Vehicles

• 2005 – 2006 model year ES 330 vehicles produced BEFORE the Production Change Effective VIN shown below.

Production Change Information

MODEL	ENGINE	PRODUCTION CHANGE EFFECTIVE VIN	
ES 330	3MZ-FE	JTHBA3#G#65148433	

Parts Information

MODEL	ENGINE	PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
50.000	3MZ-FE	89467–33100	Same	Sensor, Air Fuel Ratio (Bank 1)	1
ES 330		89467–33110	Same	Sensor, Air Fuel Ratio (Bank 2)	1

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
895131	R & R A/F Sensor	0.6	89467–33100 89467–33110	8A	71

Applicable Warranty*:

This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.

^{*} Warranty application is limited to correction of a problem based upon a customer's specific complaint.

Required SSTs

ITEM NO.	SPECIAL SERVICE TOOLS (SSTs)	PART NUMBER	QTY	DRW**
1	Lexus Diagnostic Tester Kit* NOTE: • All components from this kit/set are required • 12 Megabyte Diagnostic Tester Program Card (P/N 01002593–005) with version 13.0a Software (or later) is required	LEX220036	1	8
2	CAN Interface Module Kit* NOTE: • All components from this kit/set are required	01002744	1	8

^{*} Essential SSTs.

NOTE:

Additional Diagnostic Tester Kits, CAN Interface Modules, Program Cards, or other SSTs may be ordered by calling SPX/OTC at 1-800-933-8335.

Repair Procedure

DTC P0171 or P0174

Refer to the Technical Information System (TIS), 2005 or 2006 model year ES 330 Repair Manual: *Diagnostics: SFI System (3MZ–FE): P0171, P0174.*

NOTE:

Only replace the A/F sensor indicated by the M.I.L. "ON" DTC(s).

DTC P2195 or P2197

Refer to TIS, 2005 or 2006 model year ES 330 Repair Manual: *Diagnostics: SFI System (3MZ–FE): P2195, P2197.*

NOTE:

Only replace the A/F sensor indicated by the M.I.L. "ON" DTC(s).

^{**} Refers to drawer number in SST Storage System.