



**Technical Service  
BULLETIN**

September 1, 2005

Title:  
**WHISTLE/HOOT NOISE FROM  
AUTOMATIC TRANSAXLE**  
Models:  
**'03 – '08 Corolla (1ZZ-FE)**

R E V I S E D

**TC012-05**

**TRANSMISSION & CLUTCH**

**TSB REVISION NOTICE:**

- October 26, 2007: 2007 and 2008 model years have been added to Applicable Vehicles. Previous versions of this TSB should be discarded.

**Introduction** Some 2003 – 2008 model year Corolla vehicles equipped with the 1ZZ-FE engine and an automatic transaxle (ATM) may exhibit a “whistle” or “hoot” noise under light acceleration at 35 – 40 mph (56 – 64 km/h) with the ATM at normal operating temperature. ATM cooler lines have been modified to reduce this condition on customer complaint vehicles.

**Applicable Vehicles** • 2003 – 2008 model year **Corolla** vehicles equipped with the **1ZZ-FE engine** and an **automatic transaxle (ATM)**.

<b>Parts Information</b>	<b>PREVIOUS PART NUMBER</b>	<b>ORIGIN</b>	<b>CURRENT PART NUMBER</b>	<b>PART NAME</b>	<b>QTY</b>
	90080-44124 90080-44125	NAP	32941-12360	Hose, Oil Cooler Inlet	1
	90445-15050 90445-15058	JPP			
	90080-44124 90080-44125 90445-15058	NAP	32942-12140	Hose, Oil Cooler Outlet	1
	90080-44124 90080-44125	NAP	N/A	Tube Sub-assembly, Oil Cooler Outlet, No. 2	1
	N/A		32928-12040	Clamp, Flexible Hose, No. 1	1

<b>Warranty Information</b>	<b>OP CODE</b>	<b>DESCRIPTION</b>	<b>TIME</b>	<b>OPP</b>	<b>T1</b>	<b>T2</b>
	369311	R & R Oil Cooler Hose	1.3	32907-02030 (NAP) 32907-13010 (JPP)	91	57

**Applicable Warranty\*:**

**This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.**

\* Warranty application is limited to correction of a problem based upon a customer's specific complaint.




Toyota Supports ASE Certification

Page 1 of 2

**Repair Procedure**

1. Remove the existing ATM oil cooler lines from the radiator and ATM.
2. Remove the two 10 mm bolts that fasten the metal cooler lines to the lower radiator support.

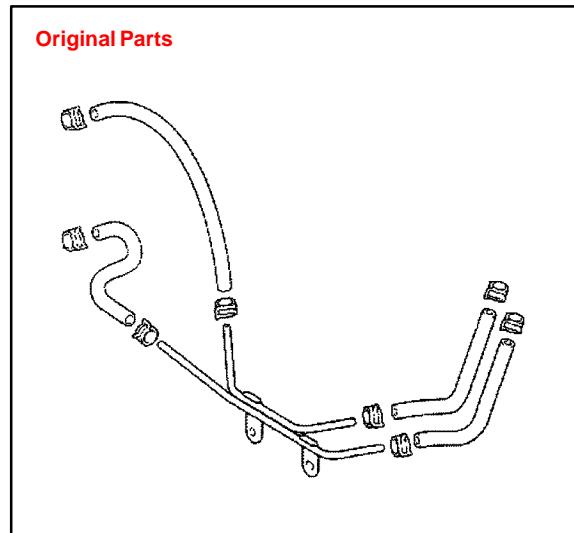

3. Install the replacement service parts per the instructions below.
  - A. Orient the yellow and white paint marks as shown in diagram (yellow towards radiator, white towards ATM) and install hose to tube.
  - B. Insert hose securely to stopper of radiator tube and cooler tube.

**NOTE:**

When installing, make sure no foreign matter enters tube and hose. When hose is fixed to the clamp, tube should not be bent and hose should not be twisted.

- C. While turning stopper of clamp fitting to radiator support, tighten oil cooler hose clamp to the following specifications:  
**Torque: 5 N·m (4 ft·lbf, 5.5 kgf·cm)**
4. Verify ATM fluid level is correct and check for ATF leaks at ATM cooler lines.

